

## 2-DNL-297

2-DNL-297 · 1,0 Ecoboost Titanium 125pk · 7 May 2026 · Zaventem (BE)

### Specifications

License Plate Number	2-DNL-297	Fuel Type	Gasoline
Manufacturer	FORD	VIN	WF02XXERK2NA34358
Model	Puma	Cylinder Capacity	999 <sup>cm<sup>3</sup></sup>
Model Versions	1,0 Ecoboost Titanium 125pk	Transmission Type	Handmatig geschakelde transmissie
Body Type	5 door hatchback	First Admission	31-01-2023
Color	Grey	Odometer	94.099 <sup>Km</sup>
Paint Type	Metallic	Numer Of Keys	2
Production Year	2023	Interior	Grey
KW	92	Number Headrests	5

# Images





## Accessories

ABS

Airbags

Audio System

Automatic air conditioning

Bluetooth car kit

Central door locking

Centre armrest

Cruise control

Electric rear windows

Electric windows front

Electrically adjustable exterior mirrors

Leather steering wheel

Navigation system

Rear parking sensors

Seat heating

Steering wheel multifunction

Steeringwheel - Heated

Windscreen - Heated

## Condition

Condition exterior Adequate

Condition interior Adequate

Last Maintenance Unknown

Previous Repairs

Unknown

## Tire Specifications

Tire	Profile	Brand	Width	Aspect Ratio	Radial	Type
Front Left	5 <sup>mm</sup>	Goodyear	215 <sup>mm</sup>	55 <sup>mm</sup>	17 <sup>inch</sup>	Summer
Rear Left	1 <sup>mm</sup>	Goodyear	215 <sup>mm</sup>	55 <sup>mm</sup>	17 <sup>inch</sup>	Summer
Front Right	5 <sup>mm</sup>	Goodyear	215 <sup>mm</sup>	55 <sup>mm</sup>	17 <sup>inch</sup>	Summer
Rear Right	1 <sup>mm</sup>	Goodyear	215 <sup>mm</sup>	55 <sup>mm</sup>	17 <sup>inch</sup>	Summer
Spare Tire Type		None				

## Damages



Damage Part

Damage Type

Repair Type

Acceptable

Fender - Front Right

Stonechipping

Touch-up

No



Damage Part

Damage Type

Repair Type


Acceptable

Wheelcover - Right Front

Damaged

Replace

No

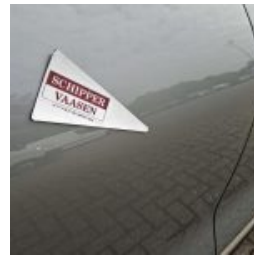

Damage Part

Damage Type

Repair Type

Acceptable

Reardoor - Right

small dents / small scratches

Panelbeating & Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

Fender - Rear Right

Scratch(es)

Spray

No



Damage Part

Damage Type

Notes

Repair Type

Acceptable

Roof

Scratch(es)

Dakstijl

Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

Roof

Scratch(es)

Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

Skirt - Right

Scratch(es)

Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

spoiler RB

Scratch(es)

Spotrepair

No



Damage Part	Damage Type	Repair Type	Acceptable
Bumper - Rear	Scratch(es)	Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Tailgate	small dents / small scratches	Panelbeating & Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Wheelcover - Right Rear	Damaged	Replace	No



Damage Part	Damage Type	Repair Type	Acceptable
Overfender	Small scratch(es)	Replace	No



Damage Part	Damage Type	Repair Type	Acceptable
Reardoor - Left	Stonechipping	Touch-up	No



Damage Part

Damage Type

Repair Type

Acceptable

Frontdoor - Left

Dent(s) & Scratch(es)

Panelbeating & Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

spoiler FB

Small dent(s)

Plastic Repair

No



Damage Part

Damage Type

Repair Type

Acceptable

Overfender

Scratch(es)

Replace

No



Damage Part

Damage Type

Repair Type

Acceptable

Bumper - Front

Scratch(es)

Spray

No



Damage Part	Damage Type	Repair Type	Acceptable
Trunkshelf	Missing	Replace	No