


2-FAJ-879


2-FAJ-879 · Move 1.0 110PS AT / Winter-Paket · 8 May 2026 · Zaventem (BE)

Specifications

License Plate Number	2-FAJ-879	VIN	VSSZZZKJ5RR087487
Manufacturer	SEAT	Cylinder Capacity	999 ^{cm³}
Model	Arona	Transmission Type	Automatisch geschakelde Transmissie
Model Versions	Move 1.0 110PS AT / Winter-Paket	First Admission	06-03-2024
Body Type	5 door hatchback	Odometer	65.237 ^{Km}
Color	Blue	Numer Of Keys	2
Paint Type	Metallic	Interior	Grey
Production Year	2024	Number Headrests	5
Fuel Type	Gasoline		

Images

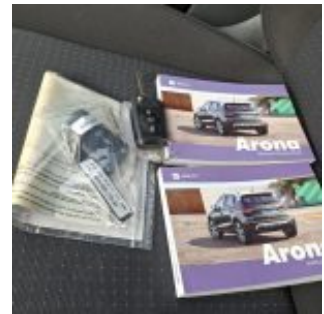

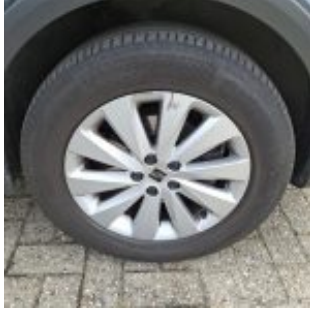

Accessories

ABS

Airbags

Alloy wheels

Audio System

Automatic air conditioning

Bluetooth car kit

Central door locking

Centre armrest

Cruise control

Electric rear windows

Electric windows front

Electrically adjustable exterior mirrors

Front & rear parking sensors

Leather steering wheel

Navigation system

Rear view camera

Roller cover / parcel shelf

Seat heating

Steering wheel multifunction

Condition

Condition exterior Adequate Last Maintenance Unknown

Condition interior Adequate Maintenance Remarks Olieverversen over 12400 km

Smoked in the car Previous Repairs Unknown

Tire Specifications

Tire	Profile	Brand	Width	Aspect Ratio	Radial	Type
Front Left	1 ^{mm}	Hankook	205 ^{mm}	60 ^{mm}	16 ^{inch}	All Season
Rear Left	5 ^{mm}	Hankook	205 ^{mm}	60 ^{mm}	16 ^{inch}	All Season
Front Right	5 ^{mm}	Continental	205 ^{mm}	60 ^{mm}	16 ^{inch}	Summer
Rear Right	5 ^{mm}	Hankook	205 ^{mm}	60 ^{mm}	16 ^{inch}	All Season
Spare Tire Type	Compressor					

Damages



Damage Part

Damage Type

Repair Type

Acceptable

Windscreen - Front

Chipped

Window Repair

No



Damage Part

Damage Type

Repair Type


Acceptable

Fender - Rear Right

Small dent(s)

Restyle

No

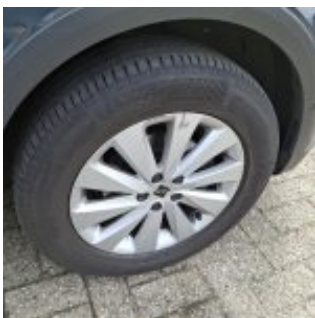

Damage Part

Damage Type

Repair Type

Acceptable

Alloy - Right Front

Damaged

Rim repair

No



Damage Part

Damage Type

Repair Type

Acceptable

Overfender

Small scratch(es)

Acceptable

Yes



Damage Part

Damage Type

Notes

Repair Type

Acceptable

Tailgate

Scratch(es)

Spoiler

Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

Overfender

Scratch(es)

Replace

No



Damage Part	Damage Type	Repair Type	Acceptable
spoiler RB	Scratch(es)	Plastic Repair	No



Damage Part	Damage Type	Repair Type	Acceptable
Bumper - Rear	Scratch(es)	Spray	No



Damage Part	Damage Type	Notes	Repair Type	Acceptable
Interior	Burned	Vloerbedekking	Cloth Repair	No

Damage Part	Damage Type	Repair Type	Acceptable
Fender - Front Left	Small dent(s)	Restyle	No