


2-GDK-484

2-GDK-484 · 1.8 Hybrid Safety Pack DYNAMIC 1.8 140PS AT · 8 May 2026 · Zaventem (BE)

Specifications

License Plate Number	2-GDK-484	VIN	JTNADADB10J023478
Manufacturer	TOYOTA	Cylinder Capacity	1.798 ^{cm³}
Model	Corolla	Transmission Type	Automatisch geschakelde Transmissie
Model Versions	1.8 Hybrid Safety Pack DYNAMIC 1.8 140PS AT	First Admission	05-11-2024
Body Type	5 door hatchback	Odometer	41.939 ^{Km}
Color	Black	Numer Of Keys	2
Paint Type	Metallic	Interior	Grey
Production Year	2024	Number Headrests	5
Fuel Type	Hybrid Gasoline		

Images

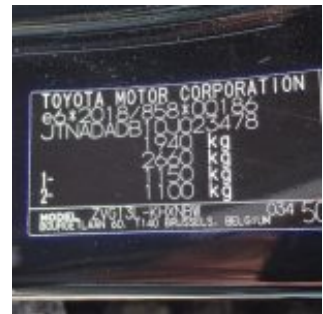



Accessories

ABS

Airbags

Alloy wheels

Audio System

Automatic air conditioning

Bluetooth car kit

Central door locking

Centre armrest

Cruise control

Electric rear windows

Electric windows front

Electrically adjustable exterior mirrors

Fog lights

Front & rear parking sensors

Leather steering wheel

Navigation system

Rear view camera

Roller cover / parcel shelf

Steering wheel multifunction

Condition

Condition exterior Adequate

Condition interior Adequate

Last Maintenance Unknown

Previous Repairs Unknown

Tire Specifications

Tire	Profile	Brand	Width	Aspect Ratio	Radial	Type
Front Left	6 ^{mm}	Uniroyal	215 ^{mm}	60 ^{mm}	17 ^{inch}	All Season
Rear Left	7 ^{mm}	Uniroyal	215 ^{mm}	60 ^{mm}	17 ^{inch}	All Season
Front Right	6 ^{mm}	Uniroyal	215 ^{mm}	60 ^{mm}	17 ^{inch}	All Season
Rear Right	7 ^{mm}	Uniroyal	215 ^{mm}	60 ^{mm}	17 ^{inch}	All Season
Spare Tire Type		None				

Damages



Damage Part

Damage Type

Repair Type

Acceptable

Reardoor - Right

Scratch(es)

Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

Tailgate

Scratch(es)

Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

spoiler RB

Scratch(es)

Plastic Repair

No



Damage Part

Damage Type

Repair Type

Acceptable

Fender - Rear Left

Scratch(es)

Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

Roof

Small dent(s)

Restyle

No



Damage Part

Damage Type

Repair Type

Acceptable

Reardoor - Left

Small dent(s)

Restyle / Touch-up

No



Damage Part

Damage Type

Repair Type

Acceptable

Frontdoor - Left

Door-edge chipped

Acceptable

Yes



Damage Part

Damage Type

Notes

Repair Type

Acceptable

spoiler FB

Scratch(es)

En ontzet

Panelbeating & Spotrepair

No



Damage Part

Damage Type

Repair Type

Acceptable

Bumper - Front

Scratch(es)

Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

Hood

Scratch(es)

Spray

No